

## SERVICE INSTRUCTIONS

REFERENCE: FSA202122

DATE: 10.12.2021

SUBJECT: Cluster Calibration Update

FSA TYPE: Recall

### Introduction

**FSA202122:** In Specified vehicles; Cluster software should be updated for the cluster warning (buzzer) sounds is not working, The relevant procedure is valid for vehicles manufactured between 01/07/2021 and 28/10/2021.

### Labour:

Labour	Labour Name	Duration
33C005 F	Cluster Update and Control (FSA202122)	0,6

### Service Application

1-Run the FODP2 / FODIT program and use "Auto Scan" function to detect the control units. Then select "Cluster" module.

2- After Cluster module is selected, it should be updated by using flashing functions.


3- After flashing cluster module, software level is JC46-14C026-CF or higher.

4- Please apply below steps after flashing process;

- Control: After flashing process, please switch between menus of the module.
- Control: Please check hazard light warning sound after push it's button.
- Control: Please check differential lock sound after push it's button.
- Control: Please check open door warning sound after open the doors.
- Control: Please check the SW level if's JC46-14C026-CF or higher.
- Control: Please check above steps with the 2nd key **if it's available**.

**Important Note:** If the problem is still exist after flashing process, please contact with Service Engineering Team for further steps.

### FODIT ECUID SCREEN

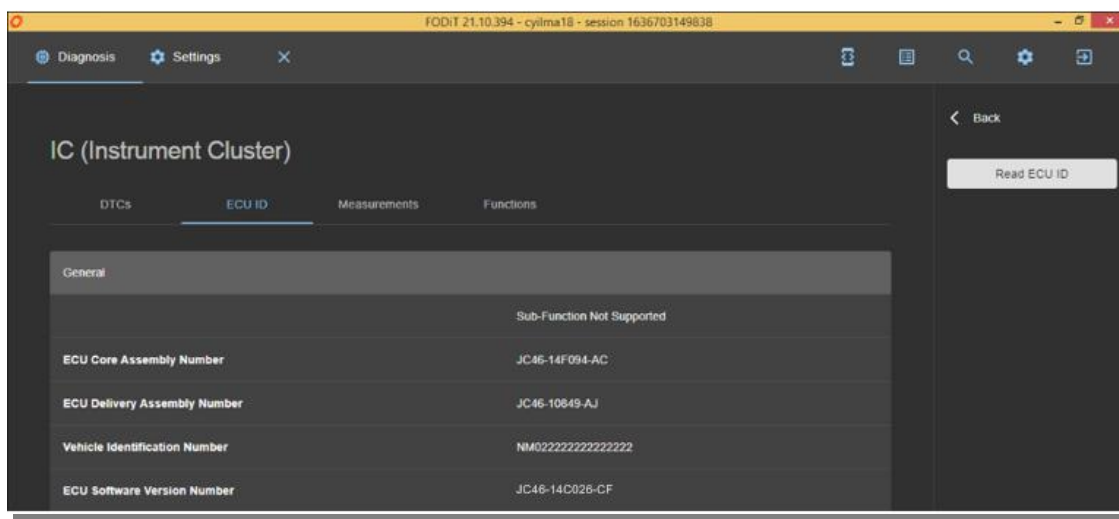

## SERVICE INSTRUCTIONS


REFERENCE: FSA202122

DATE: 10.12.2021

SUBJECT: Cluster Calibration Update

FSA TYPE: Recall

### FODP ECUID SCREEN

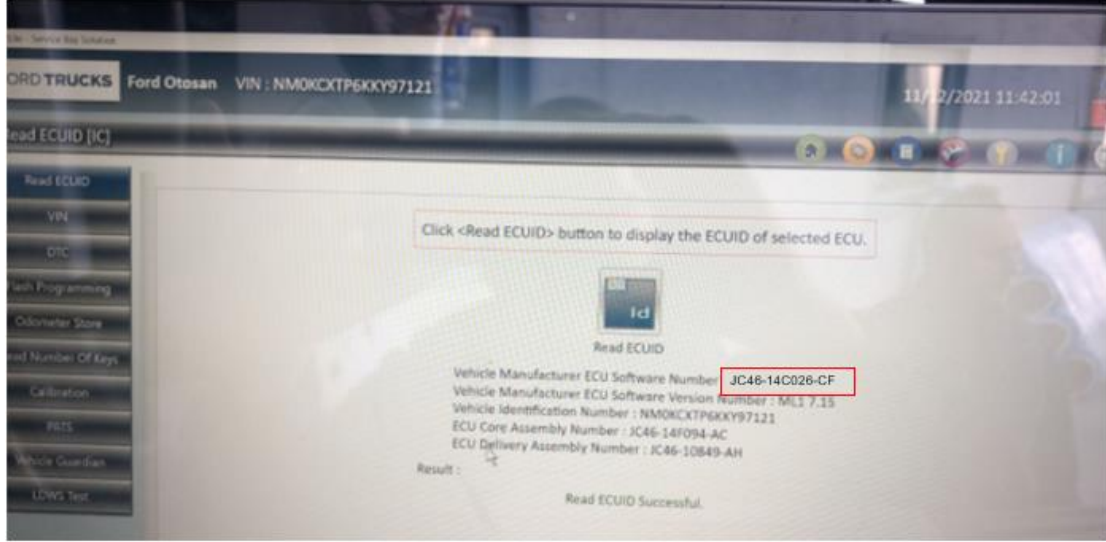

#### Important Note:

After flashing process, screenshot which is including VIN Number and software version (given above) from Read ECUID screen must be added to the claim card.

Ford Trucks Service Engineering  
Ford Otosan A.Ş